

| Sample # | Sample Date | General Sample Location                     | Sample Surface           | Asbestos Structures Counted | Asbestos (Conc.) Str/Ft <sup>2</sup> | Asbestos (Conc.) Str/Cm <sup>2</sup> | Relative Contamination Level |
|----------|-------------|---|--------------------------|-----------------------------|--------------------------------------|--------------------------------------|------------------------------|
| 1        | 9/7/2006    | ASH Admin 1st floor Credit Union            | top of window ledge      | 53                          | $3.12 \times 10^8$                   | $3.53 \times 10^5$                   | Heavy                        |
| 2        | 9/7/2006    | ASH Admin 1st floor                         | top of window ledge      | 34                          | $3.96 \times 10^7$                   | $4.26 \times 10^4$                   | Moderate                     |
| 3        | 9/7/2006    | ASH Admin 3rd floor - Alcohol & Drug Office | top of storage shelf     | 103                         | $2.03 \times 10^9$                   | $2.18 \times 10^6$                   | Extreme                      |
| 1        | 9/7/2006    | ASH Canteen G floor - main dining area      | top of refrigerator unit | 3                           | $4.34 \times 10^6$                   | $4.68 \times 10^3$                   | Slight                       |
| 1        | 9/7/2006    | ASH Admissions G floor - Admissions Counter | top of back cabinets     | 48                          | $2.65 \times 10^9$                   | $2.85 \times 10^6$                   | Extreme                      |
| 2        | 9/7/2006    | ASH Admissions G floor - Medical Records    | top of medical files     | 58                          | $8.40 \times 10^8$                   | $9.04 \times 10^5$                   | Heavy                        |

Photographs: ASH – Hospital Administration, Canteen, Nursing Administration and Admissions Buildings

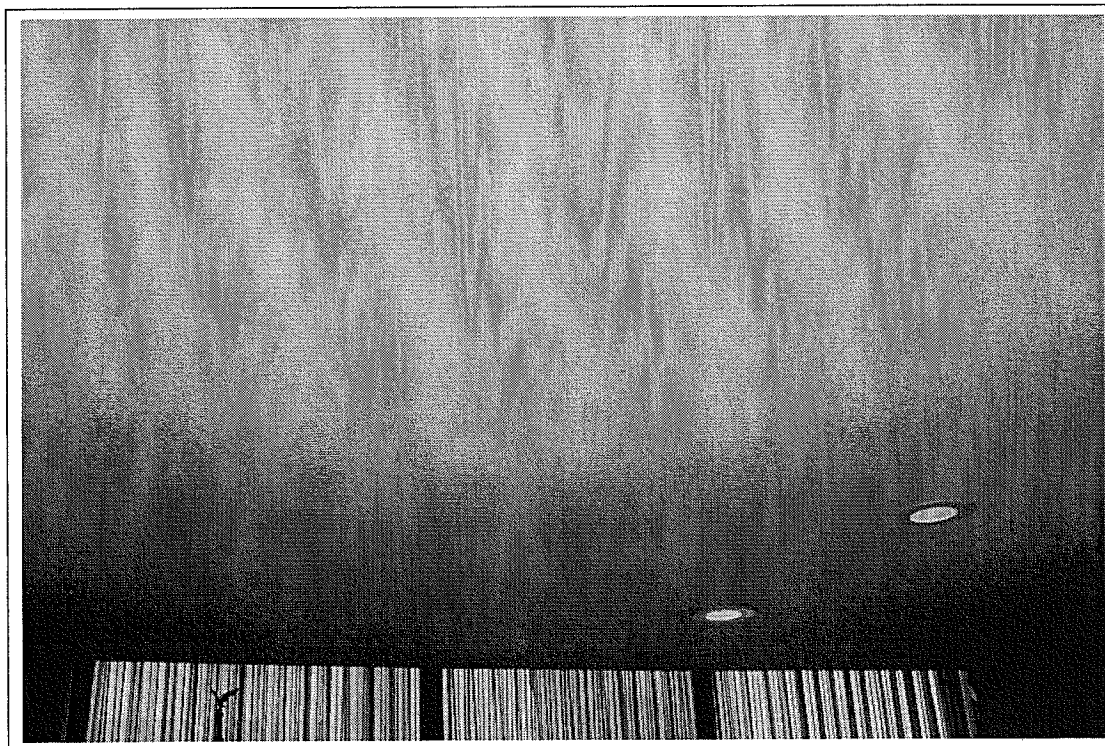


Photo 33. Hospital Administration Bldg. 1st floor visitors lounge area - General view of impact damage to acoustical plaster in lobby

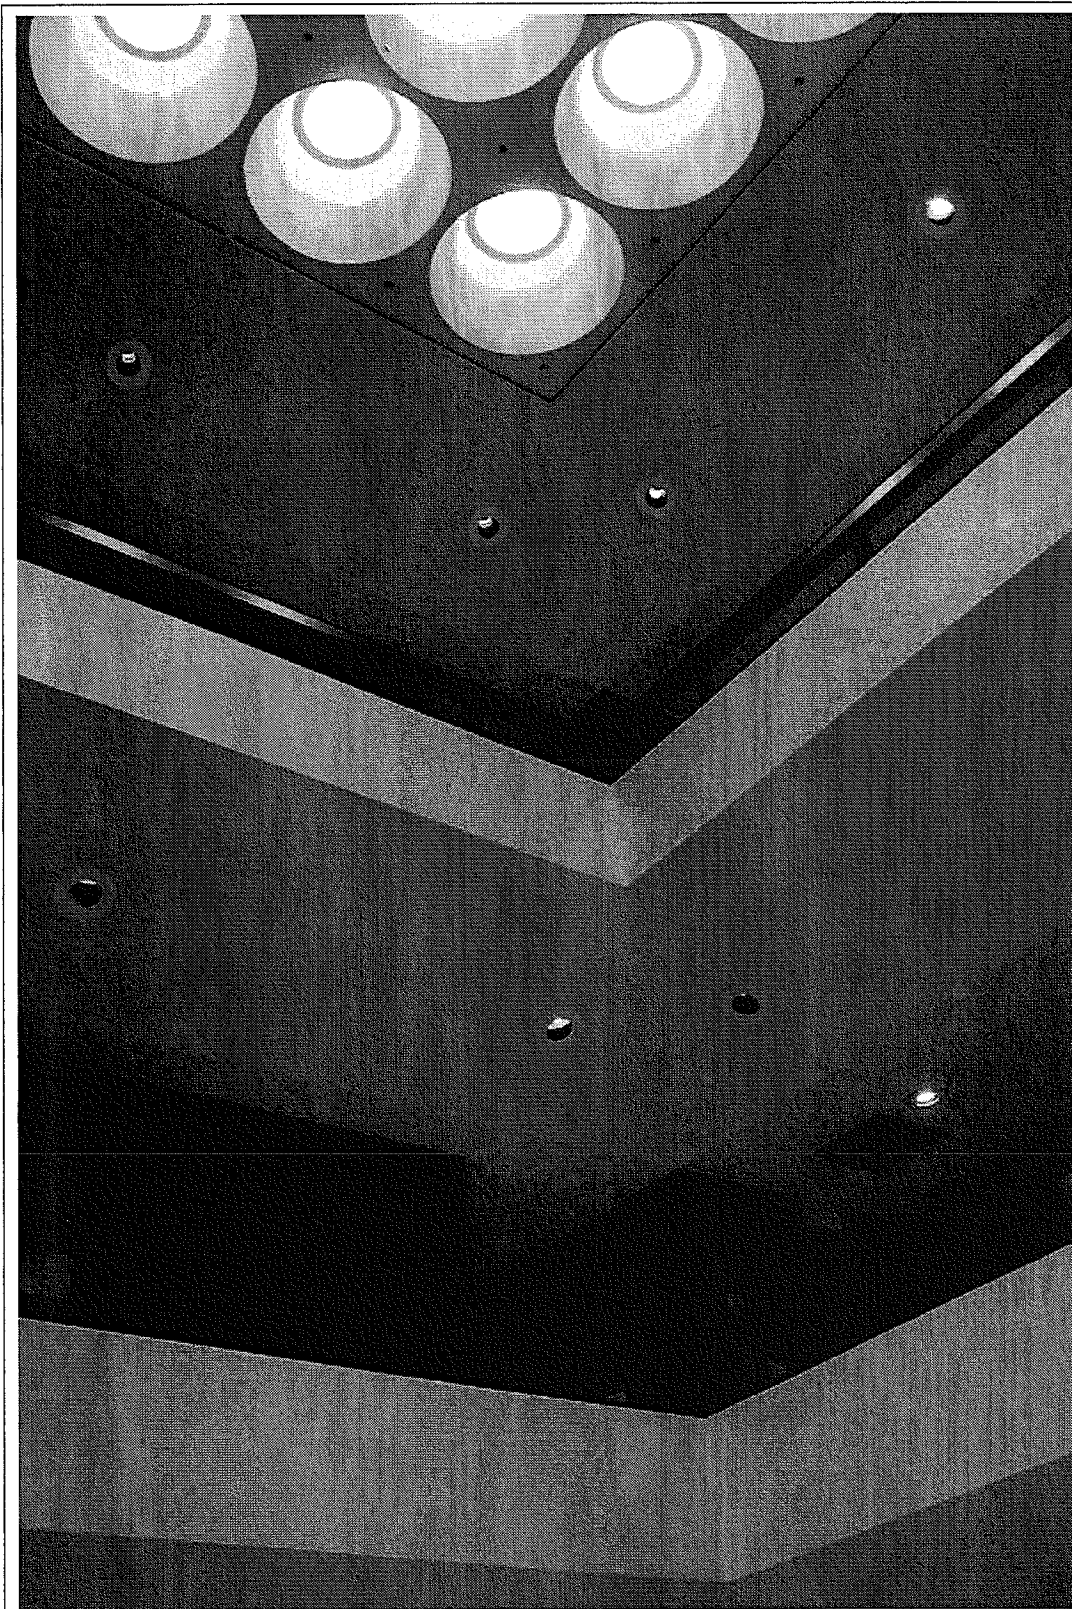


Photo 34. Hospital Administration Bldg. 1st floor visitors lounge area - General view of acoustical plaster in atrium lobby/visitors lounge area

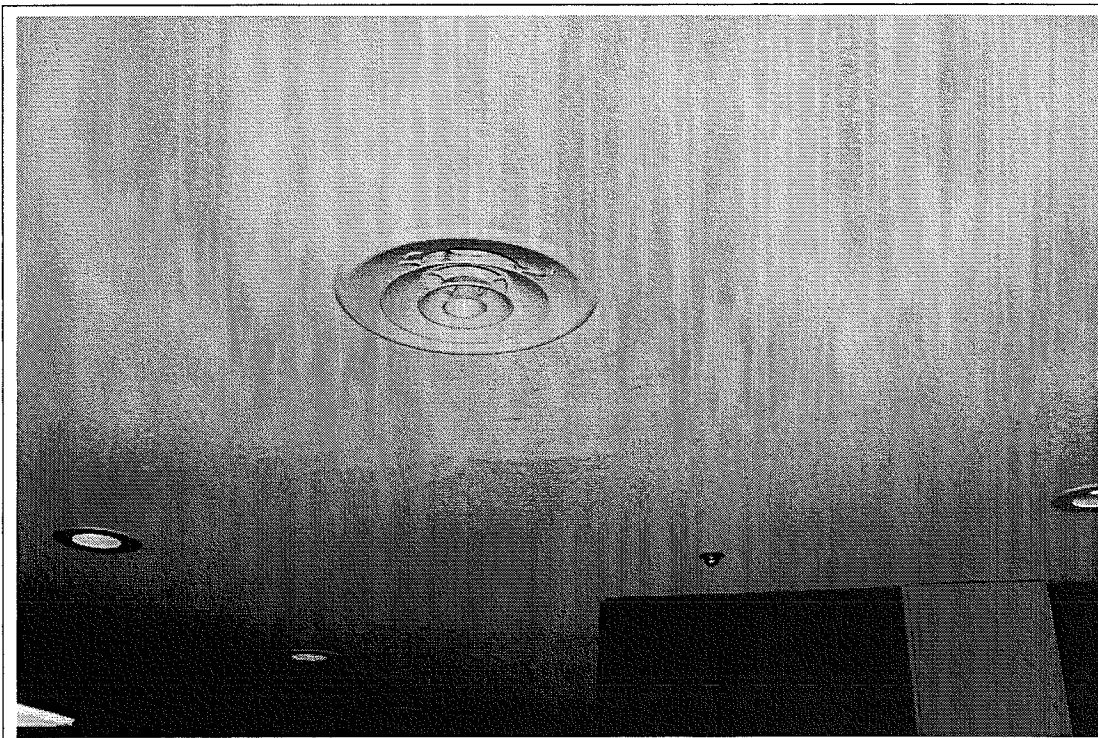


Photo 35. Hospital Administration Bldg. 1st floor visitors lounge area - View of water damaged acoustical plaster next to ceiling diffuser

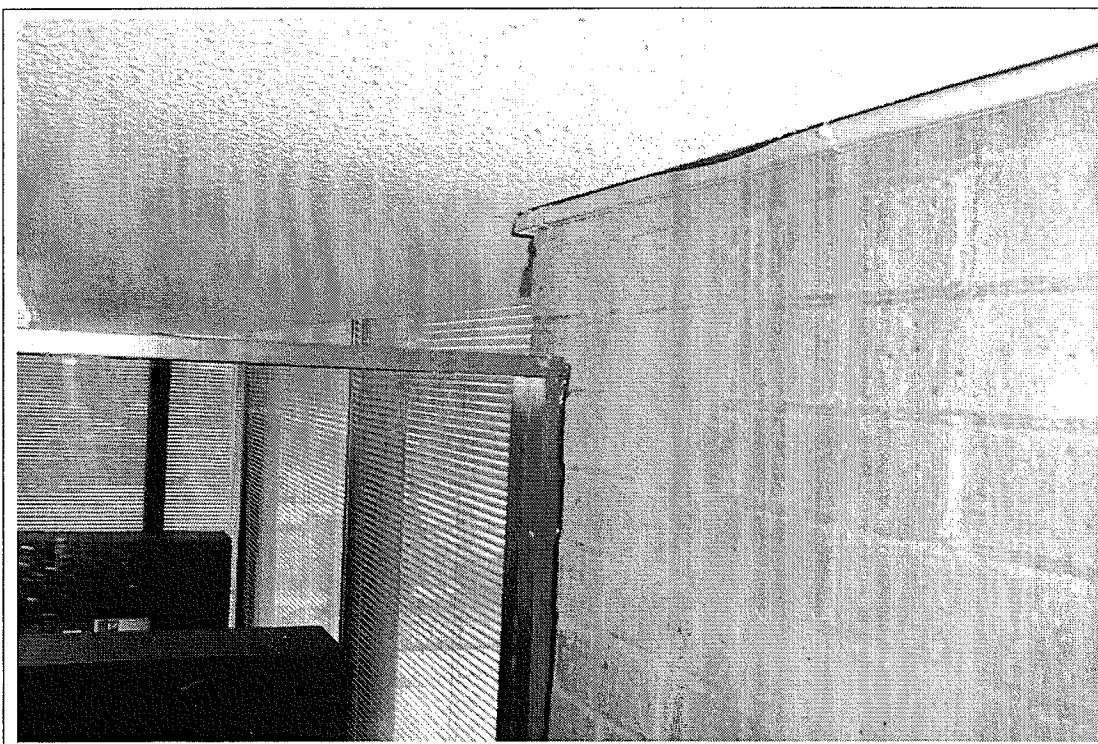


Photo 36. Hospital Administration Bldg. 1st floor SW hallway - Acoustical plaster above door to staff development office (general location of dust sample #2 - top of door frame)

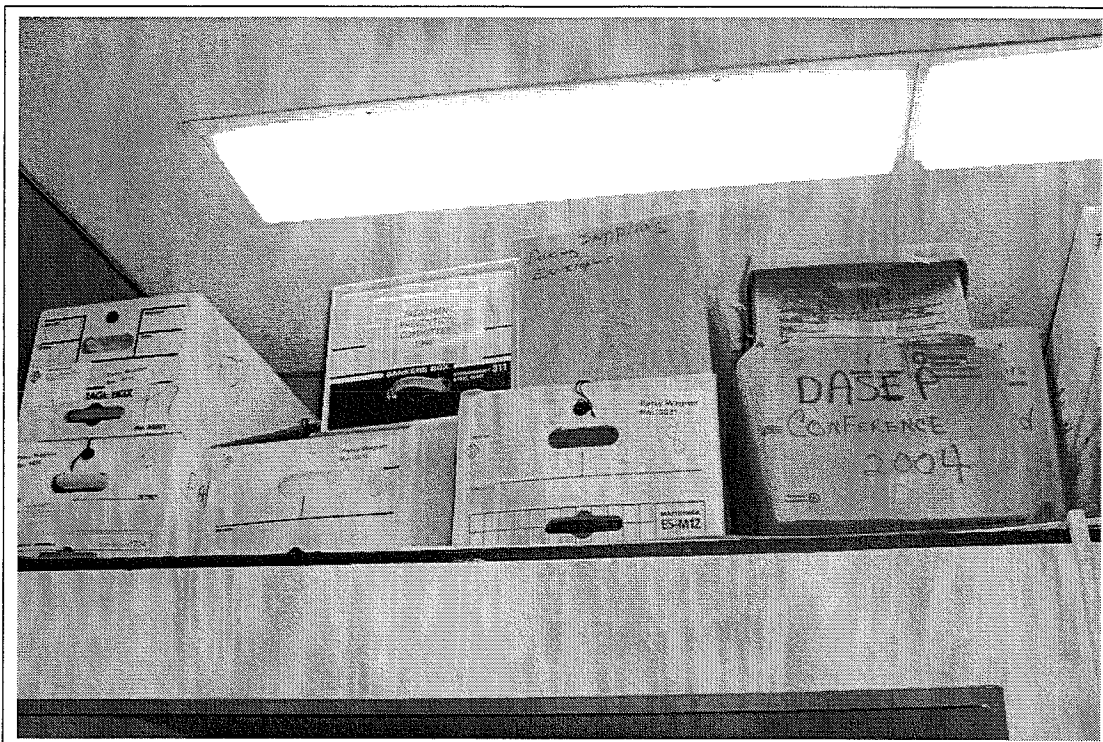


Photo 37. Hospital Administration Bldg. 3rd floor Alcohol & Drug Abuse Office – Location of dust sample #3 – top of wood storage shelf beneath acoustical plaster finish

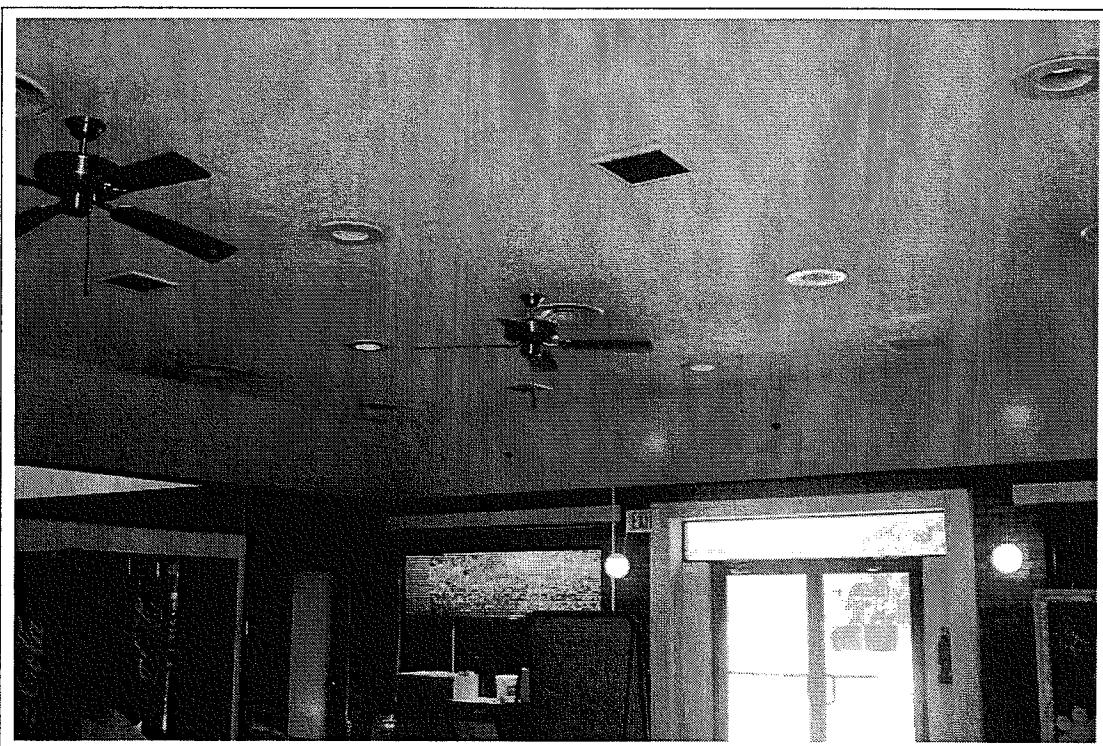


Photo 38. Canteen Bldg. Dining Area - General view of acoustical plaster ceiling above dining tables